


Scientific Colloquium on High Voltage Engineering

**Košice – Slovakia
June 11-12 , 2002**

Proceedings

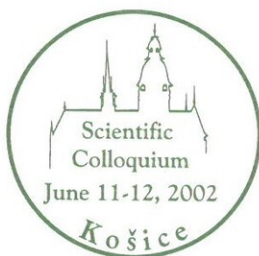

Supported by
Slovak Electrotechnic Society

Technical University of Košice
Faculty of Electrical Engineering and Informatics



TECHNICAL UNIVERSITY OF KOŠICE
FACULTY OF ELECTRICAL ENGINEERING AND INFORMATICS
DEPARTMENT OF HIGH VOLTAGE ENGINEERING
Mäsiarska 74
040 01 Košice, Slovakia

ISBN 80-89061-54-0

Edited by: Ing. Jaroslav Džmura
Jana Varnavčinová

No responsibility is assumed by the publisher of any injury and/or damage to persons or property as a matter of products liability negligence or otherwise, or from any use or operation of any methods, products, instructions or ideas contained in the material herein.

Printed in Slovakia

Foreword

It is a great honour for me to welcome participants of the International Scientific Colloquium on High Voltage Engineering organized under shelter of Excellencies of Visegrad's Group countries, Messrs. General Consul of Czech Republic, Jozef Byrtus, General Consul of Magyar Republic, György Varga, and Ambassador of Polish Republic Jan Komornicki.

We are glad that except scientists and educationists from V-4 our colleagues from Austria, Germany and Russia accepted our invitation also. In the course of such important opportunity it is convenient to look back to history and mention some notices about genesis and existence of organizer.

The Joint Laboratory of High Voltage Engineering was established in 1975 as a common work place of Technical University Electrotechnical Faculty and East Slovak Power Engineering Factories. Results of branch the applied and basic research have had a great influence on education process at faculty. International conferences on high voltage engineering have gained a respect of scientific and education community. After 1991, when Department of High Voltage Engineering was established, the cooperation with notable education and industry institutions have become more intensive.

Scientific research and education activities are now orientated to electro-physical phenomena in high voltage engineering, diagnostics of hv and uhv equipments, overvoltage protection not only in power engineering but in computer systems too. Branch of ecology is covered by electron-ion technology and electromagnetic compactibility. There is not surprise that part of themes mentioned above are contents of this proceedings.

The scientific colloquium is organized in the frame of 50-th anniversary of Technical University establishment. Organization committee of the colloquium thanks authors for their serious works and grace to scientific activities hold by us.

In conclusion we thank sponsors contributed to successful agenda of the scientific colloquium. There are Východoslovenská energetika, a.s. Košice, Dopravný podnik mesta Košice, a.s., EN-Centrum, s.r.o. Praha, SEPS, a.s. Bratislava, TEHO s.r.o. Košice, Konex Elektro s.r.o. Košice, BSH s.r.o. Michalovce, , Tepláreň Košice, a.s., EneCon s.r.o. Košice. Kind thanks to Municipality of Košice for information materials about our town. In the end let me allow thanks go to Technical University of Košice and Faculty of Electrical Engineering and Informatics for their comprehensive support of the colloquium.

Košice, 3 June 2002


Karol Marton
(Chairman, International Advisory Committee)

Organising Committee

Chairman:	K. Marton
Vice Chairman:	R. Cimbala
Secretary:	J. Džmura
	J. Varnavčinová
Local Arrangements:	I. Kršňák
	I. Kolcunová

International Advisory Committee

Prof. Dr. Ing. István Berta, DrSc.
Prof. Dr.hab. inž. Romuald Wlodek
prof. Ing. Václav Mentlík, CSc.
doc. Ing. Karel Záliš, CSc.
doc. Ing. Pavol Šandrik, PhD.
Ing. Vojtech Kusý
doc. Ing. Ján Adamov, PhD.

Secretary

Technical University of Košice
Faculty of Electrical Engineering and Informatics
Department of High Voltage Engineering
Mäsiarska 74
042 10 Košice, Slovak Republic
Phone: 00 421 55 6225060
Fax: 00 421 55 6225060

CONTENTS

Wlodek, R.: <i>Probabilistic elements in high voltage diagnostic</i>	3
Szedeník, N., Kiss, I., Berta, I.: <i>Open energy market – power quality</i>	9
Šandrik, P., Zlatovský, J.: <i>Insulating system and diagnostic quantities</i>	15
Porzel, R.: <i>Zustandsdiagnostik elektrotechnischer Betriebsmittel über bildgebende verfahrenvisuelle Diagnostik der elektrischen Energietechnik am Beispiel des Hochspannungsleistungstransformators</i>	19
Mentlík, V.: <i>The aspects and perspective views of the diagnostics of electric devices</i>	25
Chrzan, K. L.: <i>Evaluation of electrical stress of polluted outdoor insulators at field stations Siechnica and Glogów</i>	31
Jedlička, R., Brestovanský, L.: <i>Profylaktické a termovízne merania elektrických strojov a zariadení</i>	37
Porzel, R., Wartschinski, D.: <i>Vergleich der Prüfungen von ADSS-kabeln an der TU Imenau mit dem Normenvorschlag IEEE 1222</i>	45
Lelák, J., Ďurman, V., Packa, J.: <i>Identification of the ageing degree of locally degraded spots in high voltage PVC cables</i>	51
Cimbala, R., Sagan, K.: <i>Thermal ageing of XLPE cables</i>	57
Kučerová, E.: <i>Factors of the quality determination of composite materials</i>	61
Hammer, M., Kozlovský T., Kratochvíl, P., Baroš, M.: <i>Neural networks in the process of diagnostics</i>	67
Boček, V.: <i>Elimination of partial discharges in the wall bushing</i>	75
Valenta, L.: <i>Philosophy of monitoring of power transformers</i>	79

Aschenbrenner, V., Učík, T., Valenta, L.: <i>Verification of efficiency of the low frequency drying of power transformers</i>	85
Dolin, A. P., Smekalov, V. V., Pershina, N. F., Degtyarev, S. A.: <i>The failure rate and procedures of inspection of power transformers in Russia</i>	91
Dolin, A. P., Smekalov, V. V., Smekalov, S. V., Tarmogin, P. V.: <i>New transformer repair technology of washing with oil containing special additives</i>	97
Skubis, J.: <i>Acoustic method of partial discharges evaluation</i>	103
Kováčik, J.: <i>Detection and location of partial discharges in power transformers</i>	109
Boczar, T., Fracz, P.: <i>Acoustic emission of single – source partial discharges of various types generated simultaneously</i>	115
Boczar, T., Fracz, P.: <i>Evaluation of the influence of the parameters of the propagation path of the acoustic emission pulses generated by partial discharges on the results of their frequency analysis</i>	121
Boczar, T., Wolny, S.: <i>Application of statistical methods in the analysis of the acoustic emission signals generated by partial discharges</i>	127
Wolny, S.: <i>Repetition and reproduction of electrification current of dielectric liquids in a two-spinning-disk system</i>	133
Neudert, E.: <i>Verfahren der te-bewertung</i>	139
Záliš, K.: <i>Actual trends and problems with partial discharge measurement of rotating electrical machines in on-line mode</i>	145
Florkowska, B., Zydrón, P., Florkowski, M.: <i>Influence of testing voltage frequency on partial discharge phase –resolved images</i>	151
Kršňák, I., Kolcunová, I.: <i>Partial discharges in high voltage rotating machines- phase resolved partial discharge analysis</i>	157
Gacek, Z., Witos, F.: <i>A new conception regarding evaluation of partial discharges for diagnosis of insulation</i> ...	161

Muhr, M., Pack, S., Körbler, B., Schwarz, R.: <i>Unkonventionelle Teilentladungsdetektion und Ortung</i>	167
Marton, K., Balogh, J.: <i>Partial discharge activity at temperature $t > 20^{\circ}\text{C}$</i>	173
Koch, R., Neudert, E., Weidner, J. R.: <i>Laufzeitortung von Teilentladungsquellen in Generatorwicklungen</i>	181
Hrůza, J., Laurenc, J., Martínek, P., Müllerová, E.: <i>Contribution to discussion about calibration problems during partial discharges measuring</i>	187
Kurimský, J.: <i>Model of the cavity in the solid insulation at different temperatures</i>	193
Aksenov, Y., Golubev, A., Muchortov, A., Rodionov, V., Zavidyev, V.: <i>The cable 110-400 kV insulation aging events as a result of PD on-line measurements</i>	199
Aksenov, Y., Golubev, A., Zavidyev, V., Rodionov, V.: <i>The diagnostic date of HV power transformers particularities for industry in comparison with utility</i>	207
Aksenov, Y., Muchortov, A.: <i>The ecsperiency of “double coordinates technologies” for turbine generator on-line PD-SITE location</i>	215
Petráš, J.: <i>Difficulties of partial discharge measurement system and calibrator design</i>	223
Horváth, T.: <i>100 years lighting recorders in Hungary and all over the world</i>	229
Chrzan, K. L.: <i>Voltage distribution along metal oxide surge arresters</i>	235
Dolník, B.: <i>Overvoltages in low-voltage AC power system</i>	241
Tamus, A., Novák, B., Kiss, I., Csuzdi, A.: <i>Examination of wave phenomena in an overvoltage protected network</i>	249
Kiss, I., Suda, J., Iváncsy, T.: <i>The effect of the spatial distribution of particles on the ESP's performance</i>	255



INTERNATIONAL SCIENTIFIC COLLOQUIUM ON HIGH VOLTAGE ENGINEERING

Košice, June 11 – 12, 2002

Slovak Republic



THE FAILURE RATE AND PROCEDURES OF INSPECTION OF POWER TRANSFORMERS IN RUSSIA

Dolin A.P., Smekalov V.V., Pershina N.F., Degtyarev S.A. – Technoservis-Electro,
Moscow, Russia

Almost half of all transformers of 110 kV and higher voltage level installed in Russia are in operation 25 years and longer. Their replacement by the new ones is technically and economically impossible and unreasonable. Considerable part of such transformer may be used for further operation. Thus the problem of their service life time prolongation is of big importance. The paper is devoted to assessment of transformer technical condition especially for long time used transformers.

1. Introduction.

At present the power industry of Russia includes about 20000 units of operating power transformers, autotransformers and shunt reactors (herein after referred to as transformers) of 110 kV and higher voltage level. The service duration of more than 40% of these transformers exceeds 25 years. The replacement of all of them is unreasonable neither economically nor technically. The actual service life of many transformers essentially exceed 25 years and it is possible to extend their service the required operational reliability being ensured.

Such reliability can be realized only if there is a possibility of a trustworthy definition of the equipment technical state.

The problem of old transformer condition estimation is considered below in this paper.

2. Results of the transformer failure analysis.

The results of transformer failure analysis carried out by the authors on the base of available statements of 110 kV and higher level and 63 MVA and higher capacity transformers as well as the data extracted from [1,2] have shown that the most important transformer failures result from bushings, windings and tap changers. Transformers practically don't fail due to the defects in magnetic cores.. Based on the data provided in [2] a rather high percent of failures is related to the improper actions of the operating service and repair personnel.

3. Transformer complex inspection.

One of the most important components of the transformer future operational safety improvement is an impartial assessment of their state and a real transfer from the system of periodically carried out repairs depending on the specified calendar time interval of transformer service to the repairs depending on their actual state. In Russia the later concept is fixed in normative documents [3, 4].

It is universally recognized that such a concept can be realized only if there is a possibility of a trustworthy definition of the equipment technical state, including the definitions made in the course of such equipment complex inspection.

A complex diagnostic inspection allows to evaluate the state of transformer as a whole and its components:

- 1) Rigid insulation (moistening, dirtying, destruction).
- 2) Magnetic system (core compressing, component to tant insulation damage, etc.).
- 3) Windings (levels clamping and fustoning deformations).
- 4) Transformer oil.
- 5) Systems of oil cooling, treatment and protection.
- 6) Bushings.
- 7) Voltage regulators and contact system.

A typical inspection program specified in Table 1 herein below includes a rather wide set of both traditional and non-traditional diagnostics procedures.

Table 1

Transformer complex inspection program Procedures of inspection, testing and measurements	Components						
	1	2	3	4	5	6	7
1. Evaluation of the most probable damage points based on the similar type transformer defects analysis	+	+	+	+	+	+	+
2. Analysis of transformed modes of operation, operational and maintenance documentation, the results of measurements and tests	+	+	+	+	+	+	+
3. Visual inspection.					+	+	+
4. Oil chromatographic analysis (DGA)	+	+			+	+	+
5. Oil chemical analysis	+	+			+	+	+
6. Definition of oil humidity at various temperatures and modes of transformer operation	+			+	+	+	+
7. Definition of availability and fractional composition of mechanical impurities in oil	+	+		+	+	+	+
8. Definition of antioxidizing additive content in oil				+	+	+	
9. Definition of oil residual stability	+	+		+	+	+	
10. Oil infra-red spectroscopy	+					+	
11. Definition of furan derivatives content in oil	+					+	+
12. tgδ and oil conductivity measurement at various temperatures	+			+	+	+	+
13. Analysis of silica gel from thermosiphon filters	+			+	+		
14. Measurement of insulation characteristics of windings and bushings at various temperatures and voltage levels, for various zones inclusive	+				+	+	
15. Definition of rigid insulation humidity based on a "paper-oil" equilibrium and on the measured values of insulation characteristics	+				+	+	
16. Measurement of partial discharges (PD)*	+	+				+	+
17. Transformer infra-red imaging*		+			+	+	+

18. Transformer acoustic inspection*	+	+	+				+
19. Vibration control of transformer tank*, oil pumps and cooling system fans		+	+		+		
20. Oscillograph record of low voltage pulses			+				
21. Short circuit impedance measurement			+				
22. Measurement of current and no-load losses, at nominal voltage inclusive		+					
23. Measurement of oil volume in the extension tank at various temperatures						+	
24. Measurement of oil pressure in the bushings at various temperatures							+
25. Calculation of bushings insulation electric strength							+
26. Measurement of direct current resistance of windings and contact resistance at various positions of tap changers							+
27. Making a circle diagram and oscillogram of on-load tap changer operation							+
28. Measurements of phase currents oil of pump and fan motors						+	
29. Complex analysis of the results obtained	+	+	+	+	+	+	+

Note. 1. Inspections marked with * are performed for two modes of operation: maximum load and no-load run.

2. The numbers 1-7 correspond to above mentioned components.

The authors have in their possession the inspection results of more than two hundred fifty transformers of capacity range from 6.3 to 1000 MVA manufactured in Russia, Ukraine, Sweden and Belgium and installed in various climatic regions of Russia, Belarus and Yugoslavia. The total service of almost 70% of the inspected transformers exceeds 25 years. About a half of them refer to large transformers (> 100 MVA). The summarized results of complex diagnostic inspections have shown that it is possible to continue operation of 30% of the inspected transformers without any serious repairs and restrictions; only 2% of them require substitution; the remaining transformers require either an overhaul (15%) or rather considerable and not expensive reconditioning (23%), or simply more frequent control rates (30%).

It is worth mentioning some general comments based on the inspection results.

1. Transformers with a long service life, as a rule, experience serious humidification. Such humidification can be caused by air ingress through some leakages missing the drying system as well as by a destruction of a rigid insulation, etc.

2. Rather often the old transformers have slime deposits on insulation caused (fig.1) by the products of oil ageing, rigid insulation destruction, metal fines from faulty oil pumps and fine silica gel fractions from thermosiphon filters.

Old transformers installed in the vicinity to chemical, metallurgical and some other production plants may have slime deposits caused by the emissions from such plants.

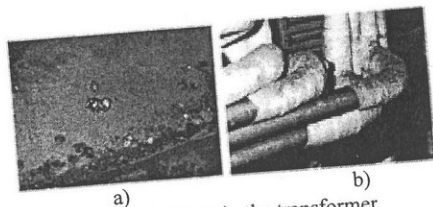


Fig.1. Slime in the transformer
(a – on active part, b – on windings)

3. The majority of transformer bushings used over 25 years require substitution or repair with opening up. Nongermetic bushings are often humidified. Their insulation characteristics deteriorates gradually. A destruction of rubber makes good conditions for colloid compounds formation and residue appearance on porcelain and insulation surfaces in nongermetic and germetetic bushings. If transformer mode of operation is changed a process of moisture adsorption by a residue may be initiated resulted in the appearance of conductive areas with possible insulation flash-over. The residue formation process is a spontaneous one and it is rather difficult to forecast it. The diagnostics of such defects is possible only by indirect indications (increase of oil tgδ, appearance of gases in oil, decrease of tgδ of bushing main insulation). It makes their revealing rather difficult.

4. Faulted loops which are often found in magnetic system structural elements lead to over heating, increased gas emission and formation of carbon at spark and arc discharges. Carbon spreading beyond the arc burning area can result in semiconducting deposit formation on the insulation of both windings and bushings (Fig.2) and in creation of conditions for flash-overs.

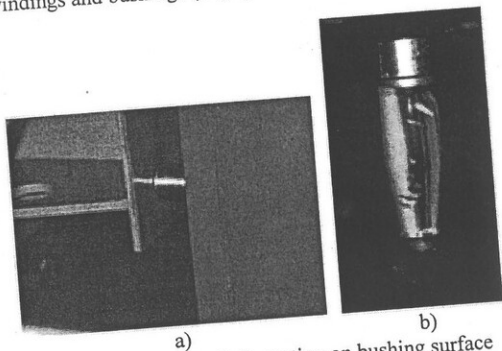


Fig. 2. Carbon deposit formation on bushing surface
a - spark discharges point in the area of the transportation bolt; b - carbon covered porcelain cap of the bushing located above the discharge area.

4. No-load losses of old transformers, as a rule, increase due to the magnetic core pressing-out and loss of insulation between the laminations.

5. Old LTC, oil cooling and protection systems usually require rather simple measures to restore them.

6. Paper insulation of the transformers with operated 25-30 years, as a rule, still have a safety margin with respect for its mechanical strength and polymerization degree. Such paper insulation can be partially restored. The transformers with a natural ageing of paper insulation, practically, are not subject to rejection.

A number of inspections listed in table 2 are performed for two modes of transformer operation: no load and maximum load. The defects related to the formation of faulted loops in magnetic system can be diagnosed best of all namely by comparison of the results obtained for the various modes of transformer operation. Efficiency of such a comparison can be illustrated on an example of infra-red imaging of autotransformer 250 MVA 330/150 kV .

It is seen in fig.3 that temperatures registered by infra-red (IR) imager of the lower parts at the tank were essentially higher in the case of on-loaded transformer than in the case of no-load operation mode. After the transformer opening up yoke beam contact to frame was revealed. The chromatographic analysis of this transformer showed only inconsiderable (52-67 ppm) increase of ethane (C₂H₆) concentration in comparison with its allowable level (50 ppm). The above mentioned defect could not be revealed by the other means: e.g. acoustic, partial discharges, vibration, etc.

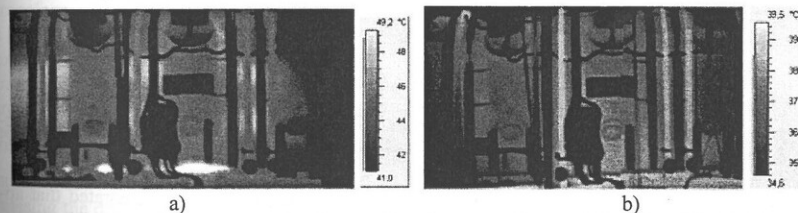


Fig. 3. Infra-red imager examination results of autotransformer 250 MVA 330/150 kV under load (a) and under no-load (b) modes of operation

But in some other cases these and some other inspection methods were adequate enough. It may be demonstrate by the example of inspection of step-up 360 MVA 220 kV transformer . An increased gas concentration was fixed in this transformer and it was assumed that a high temperature overheating affecting the rigid insulation took place there The PD measurements revealed some pulses which were identified as discharges in the magnetic system. Acoustic examination showed the availability of areas of an increased acoustic activity, including ones created by the sources with signal frequency of 30-40 kHz (marked with yellow colour in fig. 4, a). The overheated areas were revealed by IR-imager inspection (fig. 4, b).

Diagnosis: loss of tie studs insulation. After the transformer opening up it was found out that 5 tie studs had zero insulation relatively to the magnetic core.

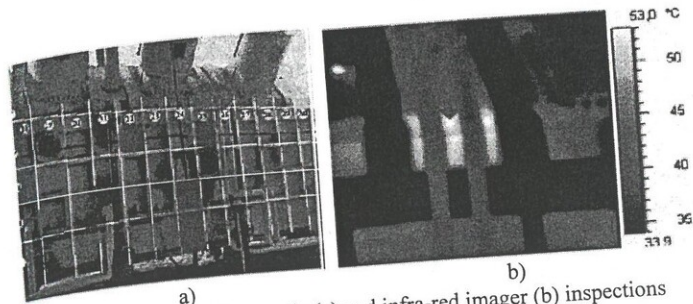


Fig. 4. Results of acoustic (a) and infra-red imager (b) inspections of step-up transformer 360 MVA 220 kV

Conclusions

1. Taking into account the objective necessity of trustworthy definition of the transformer technical state (especially for transformers with a long service time) it is reasonable to perform complex diagnostic inspections.
2. The results of such inspections of more than 250 transformers demonstrated that approximately 30% of them can be operated further on without any restrictions and only 2% require substitution. The remaining transformers require either an overhaul (15%) or rather insignificant and not expensive reconditioning (23%), or simply more frequent control of some parameters (30%).

Reference literature

- [1] B.V.Vanin, Yu.N.Lvov, M.Yu.Lvov, B.N.Neklepaev, K.M.Antipov, A.S.Surba, M.I.Chichinsky. Power transformer of 110-500 kV voltage level failures in the course of operation (Elektricheskiye stantsii, № 9, 2001 PP).
- [2] A.P.Dolin, V.K.Kraynov, V.V.Smeka-lov, V.P. Shamko. Failure rate. Assessment of state and repair of power transformers. (Energetic, № 6, 2001).
- [3] Rules of the electric station and network technical operation in Russian Federation. RD 34.20.501-95. (15-th edition. Moscow, SPO ORGRES, 1996. PP 159.
- [4] Scope and norms of the electrical equipment testing. Moscow, ENAS, 1998. PP 254.

NEW TRANSFORMER REPAIR TECHNOLOGY OF WASHING WITH OIL CONTAINING SPECIAL ADDITIVES

Dolin A.P., Smekalov V.V., Smekalov S.V., Tarmogin P.V. – Technoservis-Electro,
Moscow, Russia

The actual service life of many transformers essentially exceeds 25 years and it is possible to extend their service life the required operational reliability being ensured. New transformer repair technology of washing with oil containing special additives is considered.

1. Introduction.

At present the power industry of Russia includes about 20000 units of operating power transformers, autotransformers and shunt reactors (herein after referred to as transformers) of 110 kV and higher voltage level. The service duration of more than 40% of these transformers exceeds 25 years [1]. The problem of transformer condition estimation in Russia is considered in another paper [2]. Measures to prolong transformer service life are discussed and a new transformer repair technology of washing with oil containing special additives is considered below in this paper.

It must be noted that transformers with a long service life, as a rule, experience serious humidification. Such humidification can be caused by air ingress through some leakages missing the drying system as well as by a destruction of a rigid insulation, etc.

Rather often the old transformers have slime deposits on insulation caused by the products of oil ageing, rigid insulation destruction, metal fines from faulty oil pumps and fine silica gel fractions from thermosiphon filters [1,2].

Old transformers installed in the vicinity to chemical, metallurgical and some other production plants may have slime deposits caused by the emissions from such plants.

Old LTC, oil cooling and protection systems usually require rather simple measures to restore them.

2. Features of old transformer repair technology.

Prior to the discussion of the matters regarding the old transformer repair it is expedient to clarify the authors' position in respect to their thesis stating that the use of the traditional technologies for the repair of old transformers can be unfavourable for their condition:

Firstly, the effect of high temperatures and high vacuum results in paper partial loss of its polymerization degree. This leads to a decrease in paper mechanical strength as well as to a decrease of its remaining service life.

Secondly, drying of old insulation in order to reach moisture content levels of less than 0.5% (the level specified for new transformers) results in the increase of paper brittleness. Under the dynamic effects in the process of the transformer further operation this can lead to paper falling off with subsequent break-down or flash-over.

- Thirdly, pressing of winding up to the manufacturer levels can result long operated in paper insulation damage as well.
- Fourthly, drying of old insulation without its preliminary cleaning may result in worsening of insulation characteristics due to dirt "baking" on the insulation surface. Such transformers often fail just after they are repaired.
- Fifthly, if a transformer is contaminated by carbon formed in the course of arc burning in the short circuited electric loops, the use of a closed-loop washing system with filters of 5 μm min does not allow to remove finely dispersed carbon which spreads from the point of its formation along the whole tank and contaminates the insulation. This results in a deterioration of the insulation characteristics.

In accordance with the authors' opinion, the repair procedures should be individual for each transformer and to include several stages:

1. A complex diagnostic examination shall precede the transformer repair works. Based on the results of such examination a technically substantiated scope of repair works and the required technology shall be developed. In particular, the replacement or reconstruction of some equipment (e.g. bushing, check valves, etc.), drying, regeneration or replacement of transformer oil, method of drying and restoration of winding insulation characteristics. A scope of the required completing materials and consumables is assessed (valves, protection enclosure, silica gel, "Ionol", etc.), a plan of work performance and the other required documentation are prepared.

2. On the eve of the repair works beginning a mobile physical & chemical laboratory and, if required, electrical laboratory shall be provided in the production plant. The following equipment shall be installed at the repair site: process equipment for rigging, drying, regeneration and degassing of oil, oil heaters, units of sorbent drying and preparation, devices for the transformer active part washing.

3. Rigging works, transformer opening up and repair works performance shall be in accordance with typical nomenclature documentation requirements but taking into account with the revised process parameters mentioned above. Pressing of windings and magnetic core up to 50-60% of their prefabricated levels in particular.

4. Reconstruction of transformer individual units. In particular, the replacement of an exhaust pipe for a safety valve, transformer provision with a film system of oil protection, especially in the areas where the emissions of chemical and metallurgical production plants take place, replacement of old type bushings by the new ones, etc.

5. Preparation of oils and sorbents. This work requires considerable time period. Not only spent oils require treatment but also fresh oils from oil storages. As a rule, this treatment means drying, cleaning, degassing but in a number of cases also oil regeneration using silica gel.

If oil was used for a long time its regeneration can be ineffective from the economic viewpoint or difficult technically viewpoint. However, as the experience shows, oil of TK grade produced out of high quality oils of Baku origin (e.g. dessor oil) maintains its high dielectric properties even after 40-50 years of operation. After treatment the dielectric parameters of such oils are as good as the best parameters of new oil grades.

In the course of the repair works it is obligatory to control the moisture content in silica gel prepared for thermosiphon and air drying filters. Usually it should be dried a little. Besides, it requires oil flushing.

6. Washing and drying of insulation is one of the main repair component of the transformers with a considerable service life as well as of the transformers which experience humidification and slime deposit formation. In such cases both traditional and new solutions are recommended.

The specific features of washing and drying process are as follows: the duration of exposures of periodic heating (washing) and treating under vacuum is defined based on paper insulation mechanical strength, its moisture and slime content. Vacuum level in the transformer is defined based on the state of rigid insulation and design peculiarities of the extension tank. Heating temperature shall be the optimum one in order to obtain the best final result. In the course of washing at various stages the temperature and pressure of oil in the tank vary depending on the values of the controlled parameters.

At a certain stage of washing the ordinary transformer oil is substituted for a transformer oil solution containing detergent additive Midel 7131 and the other components. The optimum additive content in oil, defined as a result of laboratory and on location analyses, allows, from the one hand, to increase considerably the mechanical strength, and, from the other hand, to provide an active washing-out of slimes and good insulation drying.

It is worth saying that a violation of the technological conditions and content (%) of the additive sufficiently decreases the efficiency of paper insulation mechanical strength improvement and drying. These works foresee a permanent control of moisture content, class of the industrial cleanness, insulation and the other characteristics of washing oil, as well as, (if possible) of winding insulation resistance values R_{15} and R_{60} .

Additive Midel 7131 is an electrical insulation liquid produced based on halogen-free esters of pentaerythritol acid. In accordance with IEC classification it belongs to type T1; in accordance with DIN VDE 0375 it is compatible with environment and belongs to "0" water hazard class (UBA N 52330, booklet 770, Federal Health Protection Agency, Berlin). In accordance with the requirements of native GOST 12.1.007-76 "SSBT. Hazardous matters. Classification and general safety requirements" electrical insulation liquid Midel 7131 is referred to hazard class IV (moderately hazardous matters).

Moisture absorbing capability of Liquid Midel 7131 by 200 times increases the moisture absorbing capability of oil. Besides, it demonstrates a considerably higher dissolving capability.

3. The results of the repair works performed have shown a significant efficiency of a new washing technology. For example, it was possible to increase winding insulation resistance R_{60} by 2.5-5.5 times and to decrease $\text{tg}\delta$ by 5 times (Table 1) of the transformer of TDG-40500/110 type the service life of which was 44 years and which had demonstrated a high degree of humidification and contamination of rigid insulation (including contamination by iron oxides and naphthenes). The moisture content of rigid insulation control specimen was reduced by more than 2 times.

It should be noted that the developed and commercially proven technology of rigid insulation washing and drying allows to improve not insulation electrical characteristics only, but in a number of cases, the mechanical ones as well.

The IR-spectrometry and X-ray diffraction analysis of insulation specimens carried out prior and after their washing based on a new technology have shown the strengthening of hydrogen bonds in cellulose macro molecules and the improvement of crystal grating. The data of Table 2 are related to the mechanical condition classes and polymerization degrees of TDG-40500/110 type transformer rigid insulation specimen being under operation about 45 years.

Table 1

Transformer TDG-40500/110 insulation characteristics

Measurements	$t_{\text{meas.}}^{\circ}\text{C}$	Insulation characteristics reduced to 20°C at the following measurement scheme				Moisture content, %
		HV-LV+F		LV-HV+F		
		$\text{tg}\delta, \%$	R_{60}, MOhm	$\text{tg}\delta, \%$	R_{60}, MOhm	
Prior to repair	20	5.57	600	4.7	1000	3,5-4,2
After repair	27	1.2	3980	0.88	2650	1,5-1,7

Designations: HV- high voltage; LV - low voltage; F - frame.

Table 2

Mechanical condition classes and polymerization degrees of transformer TDG-40500/110 rigid insulation specimen

Insulation type	Thick-ness, mm	Specimen taking point		Mechanical condition, Class		Polymerization degree, units	
		Side	Phase	Prior to repair	After repair	Prior to repair	After repair
Barrier	2	HV, above	B & C	3-4	3	273	327
	2	HV, below	B & C	3	3	403	474
	2	HV, above	A & B	4	3	240	322
Additional insulation of taps in point of upper beech fixation	0.5	LV	A	4	3	208	377
	0.5	LV	B	4	3	238	309
	0.5	HV	A	3	2-3	341	355
	0.5	HV	B	3	2-3	326	335

Insulation mechanical condition class numbers indicated in table 2 are given in accordance with the following arbitrary specification:

Class number	Insulation mechanical condition
1	Elastic; has no damage at 180 degree bending.
2	Hard; does not crack at 180 degree bending.
3	Brittle; breaks at 180 degree bending.
4	Decrepit; breaks at 180 degree bending.

No doubt, the technology described above does not guarantee a complete renovation of old insulation. Nevertheless, in a number of cases it helps to improve by 15-20% the mechanical strength of insulation showing signs of considerable destruction as well as to improve rather effectively the insulation indices.

In such a way, the obtained results confirm the possibility to extend the service life of paper insulation and, as a result, in many cases the service life of the transformers.

Summing up it worth saying that the complex inspection cost is less than 1% of the transformer cost and the cost of the most complicated repair - not more than 10%.

Conclusions

1. A new repair technology of insulation washing with oil containing special additives allows to improved considerably the insulation characteristics of transformer windings as well as to increase the insulation mechanical strength in case of paper significant destruction as a result of cellulose crystal structure improvement.

2. Optimum selection of repair conditions (concentration of additives, vacuum level, intervals between washing operations, vacuum processing and heating) allows to restore the transformers with 35-45-year service time. Such repairs ensure the possibility of transformer service life extension.

Reference literature

- [1] A.P.Dolin, V.K.Kraynov, V.V.Smeka-lov, V.P. Shamko. Failure rate. Assessment of state and repair of power transformers. (Energetic, № 6, 2001).
- [2] V.V.Smekalov, A.P.Dolin., N.F.Pershina. The failure rate and procedures of inspection of power transformers in Russia



9 788089 061549

ISBN 80-89061-54-0